ALDERWOOD WASTEWATER TREATMENT PLANT OCTOBER 26-27, 1992

by Paul Stasch

Washington State Department of Ecology Environmental Investigations and Laboratory Services Program Toxics, Compliance and Ground Water Investigations Section Olympia, WA 98504-7710

Waterbody No. WA-PS-0240

The Department of Ecology is an Equal Opportunity and Affirmative Action employer and shall not discriminate on the basis of race, creed, color, national origin, sex, marital status, sexual orientation, age, religion or disability as defined by applicable state and/or federal regulations or statutes.

If you have special accommodation needs, please contact (appropriate program/section/unit) at (appropriate phone number), Ecology's telecommunications device for the deaf (TDD) number is (206) 438-8721.

OR FOR SWRO (TDD) 206-664-8785 NWRO (TDD) 206-649-4259 CRO (TDD) 509-454-7673 ERO (TDD) 509-458-2055

TABLE OF CONTENTS

-	age
ACKNOWLEDGEMENTS	. ii
ABSTRACT	. iii
INTRODUCTION	. 1
PROCEDURES	. 1
RESULTS AND DISCUSSION	. 4
Flow Measurements	
Quality Assurance/Quality Control	
General Chemistry	
NPDES Permit Compliance	
Split Sample Analyses	
Priority Pollutant Organics - VOA, BNA and Pesticide/PCB Scans	
Priority Pollutant Inorganics - Metals Scans	
Bioassays	
Sediments	
PECOMMENDATIONS AND CONCLUSIONS	20
RECOMMENDATIONS AND CONCLUSIONS	
Flow Measurements	. 20
Flow Measurements	. 20 . 20
Flow Measurements	. 20 . 20 . 20
Flow Measurements	. 20 . 20 . 20 . 20
Flow Measurements Quality Assurance/Quality Control General Chemistry NPDES Permit Compliance Split Sample Analyses	. 20 . 20 . 20 . 20 . 22
Flow Measurements Quality Assurance/Quality Control General Chemistry NPDES Permit Compliance Split Sample Analyses Priority Pollutants	. 20 . 20 . 20 . 20 . 22 . 22
Flow Measurements Quality Assurance/Quality Control General Chemistry NPDES Permit Compliance Split Sample Analyses Priority Pollutants Bioassays	. 20 . 20 . 20 . 20 . 22 . 22
Flow Measurements Quality Assurance/Quality Control General Chemistry NPDES Permit Compliance Split Sample Analyses Priority Pollutants	. 20 . 20 . 20 . 20 . 22 . 22

ACKNOWLEDGEMENTS

I would like to thank Marc Heffner and Bernie Strong for their assistance on the aborted sediment collection voyage. I would like to thank Casey Clishe and Bernie Strong for their assistance on the successful expedition. I would also like to thank Dave Wright for providing much appreciated regional assistance.

ABSTRACT

A Class II Inspection was conducted at the Alderwood Water District's wastewater treatment plant on October 26 and 27, 1992. Level of treatment and wastewater flow rates were acceptable during the inspection. The plant's discharge was well within the NPDES permit effluent limits. However, influent BOD₅ loading exceeded the plant's design capacity and influent TSS was at the design capacity. Planned hookups within the Alderwood Water District service area to the Metro North Creek trunk line, will reduce influent loadings to the treatment plant. Bioassays indicated only limited toxicity of the chlorinated effluent to some test organisms. Sediment bioassays demonstrated no toxic effects. The Alderwood Laboratory received accreditation as a result of the system audit conducted in conjunction with this inspection.

INTRODUCTION

A Class II Inspection was conducted at the Alderwood Water District's wastewater treatment plant on October 26 and 27, 1992. The inspection was conducted by Marc Heffner and Paul Stasch of the Toxics, Compliance and Ground Water Investigations Section of the Environmental Investigations and Laboratory Services Program (EILS) of the Washington State Department of Ecology (Ecology). Leroy Wheaton, the treatment plant operator, represented the Alderwood Water District and provided assistance onsite. Dave Wright of the Ecology Northwest Regional Office requested the inspection and was present during portions of the inspection. Dale Van Donsel and Perry Brake of the EILS Quality Assurance Section conducted a system audit of the Alderwood laboratory on October 27, 1992.

The Alderwood Water District operates two contact stabilization package plants in parallel. One of the units has a two million gallons per day capacity (2MGD) and the other has a one million gallons per day capacity (1MGD). The plant discharges chlorinated effluent directly into Puget Sound off of Picnic Point in Snohomish County (Figure 1). The flow schematic is depicted on Figure 2. Ecology issued an NPDES permit (#WA-002082-6) on June 21, 1988. The current permit expires June 30, 1993. Residential growth in the service area has raised questions about existing plant capacity and treatment capabilities.


Specific objectives of the inspection include:

- 1. Verification of compliance with existing effluent limitations;
- 2. Analysis of the treatment plant's loadings and efficiency;
- 3. Characterize influent and effluent for chemical constituents;
- 4. Assess toxicity of whole effluent and sediments near outfall; and
- 5. Evaluate the permittee's self-monitoring programs.

PROCEDURES

Ecology collected grab and composite samples from several locations within the plant. Composite samples were collected from the influent at the plant headworks (downstream from the sludge press filtrate return), from the clarifier overflow trough of both the 1MGD and 2MGD units, and at the overflow weir of the chlorine contact chamber. The Ecology Isco composite samplers were used to collect equal volumes of sample every 30 minutes for 24 hours.

Grab samples were collected at the composite sampling locations, of sludge and filtrate from the sludge press. A grab-composite sample of the effluent was collected for bioassay analyses.

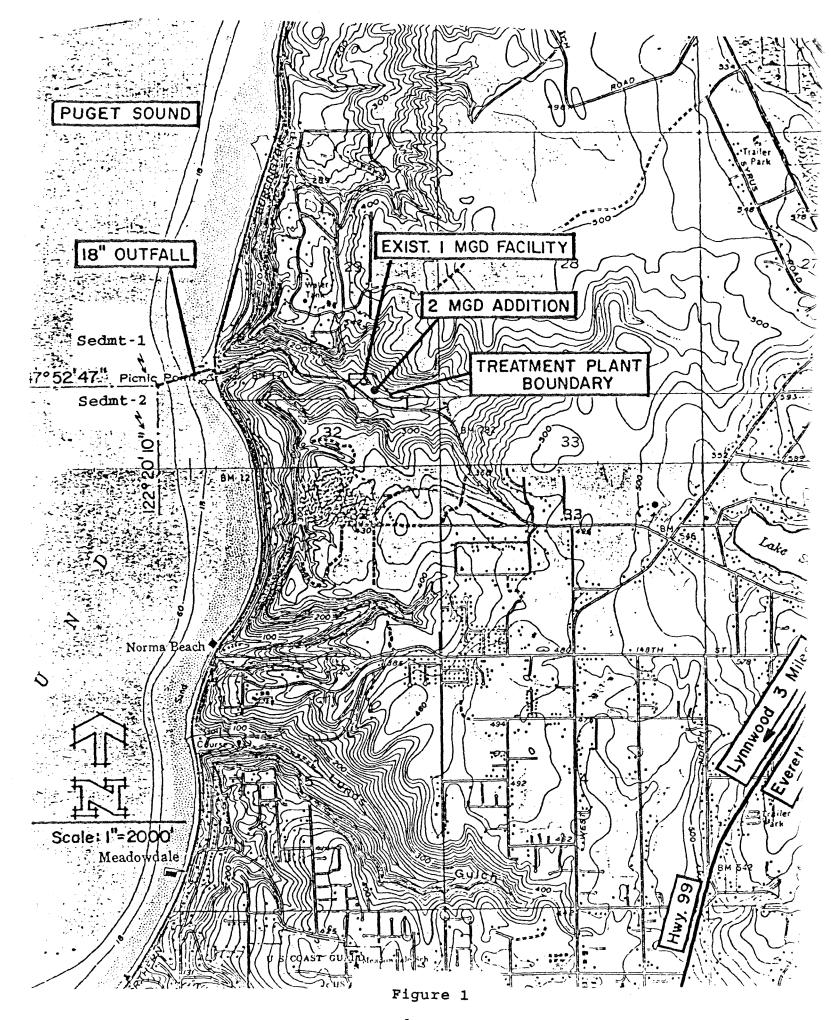

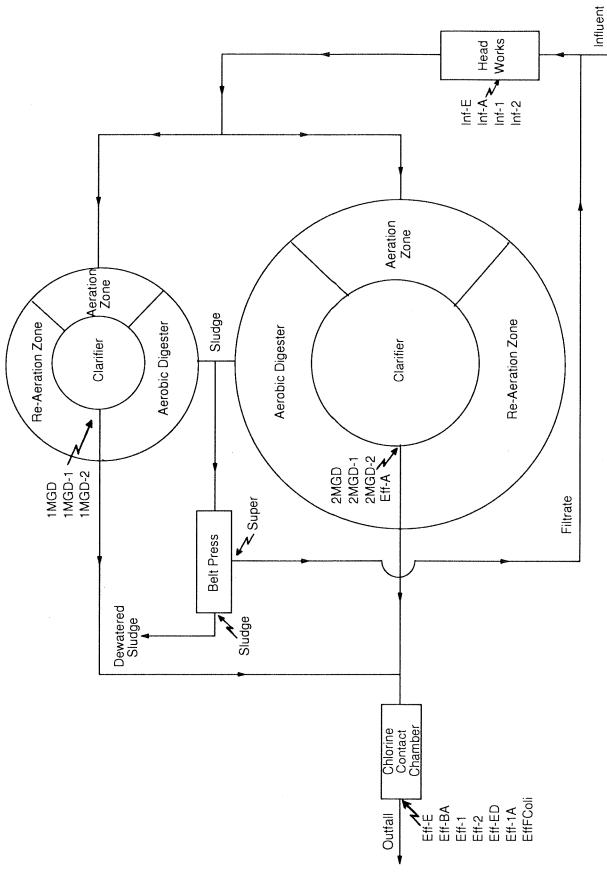


Figure 2 - Sample Stations and Flow Schematic - Alderwood - October 1992

3

Samples of sediment were collected in approximately 80 feet of water off Picnic Point on November 12, 1992. The samples were collected with a Van Veen grab sampler and composited aboard the sampling vessel. A sediment sample near the outfall and a background sediment sample were collected. The gravelly composition of the sediments near the outfall made collection of the outfall sample difficult, exhausting our available sampling time to such an extent that a second background sample could not be collected.

The location of samples collected are identified on Figures 1 and 2 and described on Table 1. The sampling dates, type of sample and parameters analyzed for are provided in Appendix A. Laboratories conducting the analyses are identified in Appendix A-1.

Alderwood operators also collected influent and effluent composite samples. The Alderwood samplers were programmed to collect an equal volume of sample every 30 minutes for 24 hours. However, the Alderwood effluent sampler malfunctioned and an insufficient volume of sample was collected. The sample identified as Eff-A was taken from the Alderwood compositor sampling the effluent from the 2MGD unit.

Sampling quality assurance/quality control (QA/QC) steps included using cleaning procedures appropriate for collecting priority pollutant samples (Appendix B) for composite samplers and sediment sampling equipment prior to the inspection (Appendix B). Samples were properly iced and delivered to our Manchester Laboratory. Chain-of-custody tracking of all sampling was maintained.

Ecology and Alderwood samples were split for analysis by both the Ecology and Alderwood laboratories to evaluate Alderwood's sampling and analytical procedures. Ecology's Quality Assurance Section conducted a system audit for laboratory accreditation in conjunction with this Class II Inspection. The system audit was conducted on October 27, 1992.

RESULTS AND DISCUSSION

Flow Measurements

The Alderwood influent Parshall flume was inspected and the flume configuration was verified to be acceptable. No instantaneous check of plant influent meter was made. Flow in the sixinch flume to the 1MGD unit and the nine-inch flume to the 2MGD unit were measured. The flow to each unit was measured twice for comparison with Alderwood's flow meter measurements. The Ecology and plant flow meter measurements agreed on all four occasions. Thus, Alderwood's flow meters appear to be recording accurate readings. The 1MGD unit was operated between 0.6-0.8 MGD. The 2MGD unit was operated between 1.2-1.4 MGD. Effluent flows were not measured.

Table 1 - Sample Station Descriptions - Alderwood Water District - October, 1992.

Inf-E

Ecology composite sample collected at the headworks of the plant, immediately downstream from the influent flume and the sludge filtrate return flow.

Inf-1,2

Grab samples collected at the headworks of the plant, immediately downstream of the influent flume and the sludge filtrate return flow.

Inf-A

Alderwood composite sample collected at the headworks of the plant, immediately downstream of the influent flume and the sludge filtrate return flow.

2MGD

Ecology composite sample collected from the clarifier overflow of the 2MGD package plant.

IMGD

Ecology composite sample collected from the clarifier overflow of the 1MGD package plant.

2MGD-1,2

Grab samples taken from the clarifier overflow of the 2MGD package plant.

1MGD-1,2

Grab samples taken from the clarifier overflow of the 1MGD package plant.

Eff-E

Ecology composite sample collected at the overflow weir of the chlorine contact chamber.

Eff-BA

Grab-composite sample collected at the overflow weir of the chlorine contact chamber.

Eff-1A,2

Grab samples collected at the overflow weir of the chlorine contact chamber.

Eff-A

Alderwood composite sample collected out of the 2MGD package plant overflow.

Eff-ED

Duplicate sample split from the Eff-E sample.

Table 1 - Sample Station Descriptions (cont.) - Alderwood Water District - October, 1992.

Sludge

Grab sample of sludge collected at the filter press.

Super

Grab sample of filtrate collected from the filter press.

Sedmt-1

Grab-composite sample collected within dilution zone off Picnic Point; Latitude 47°52'47", Longitude 122°20'10".

Sedmt-2

Grab-composite sample collected approximately south of the Sedmt-1 sample station for background comparison; Latitude 47°52'40", Longitude 122°20'10".

Quality Assurance/Quality Control

Sampling quality assurance/quality control (QA/QC) steps included priority pollutant cleaning of composite samplers and sediment sampling equipment prior to the inspection (Appendix B) and the submittal of a blind duplicate for laboratory analyses. The composite sample containers were iced to properly cool the samples as they were collected. All samples were iced and delivered to our Manchester Laboratory. Chain-of-custody tracking of all sampling was performed.

All samples submitted to the Manchester Laboratory were received in good condition, with chain-of-custody maintained. All samples were analyzed within the USEPA method holding times specified for each analyses. The results of the blind duplicate submitted for analyses were acceptable. The procedural blanks associated with the samples showed no significant levels of analytes. Laboratory control sample analyses were within the windows established for each parameter. The data provided on the tables is considered reliable and can be used noting the data qualifications included on the tables.

The EILS Quality Assurance Section conducted a System Audit for Laboratory Accreditation of the Alderwood Laboratory immediately following the Class II Inspection. The Alderwood Laboratory is now accredited as a result of this audit. The Alderwood System Audit Report, Certification, and Scope of Accreditation are provided as Appendix C.

General Chemistry

The influent to the Alderwood plant is typical of medium strength domestic wastewater (Table 2). The plant provided good treatment for the oxygen demand substances and suspended solids. Nutrient removal was moderate and some nitrification was occurring. Some oil and grease data were qualified with a J (estimated) because the samples were not acidified within the specified 24-hour period. Total residual chlorine concentrations in the effluent grab samples ranged from 0.5-1.5 mg/L. The maximum free chlorine concentration measured was 0.8 mg/L. Fecal coliform bacteria were controlled by these chlorine levels.

The purpose of collecting composite samples from the 1MGD and 2MGD units was to compare the treatment performance of each unit. The 1 MGD unit appeared to perform slightly better than the 2MGD unit. TSS and BOD₅/COD/TOC concentrations were also slightly lower in the 1MGD unit's effluent. Also, it appears the 1MGD unit is partially nitrifying the wastewater while the 2MGD unit is not. One explanation is that the 2MGD unit has inadequate aeration, resulting in lower DO concentrations in the aeration basin. The operator indicated the district's consulting engineer is investigating the lower DO concentrations he has observed in the 2MGD unit.

NPDES Permit Compliance

Compliance with the effluent limitations of the permit was good (Table 3). Ecology compositor results for BOD₅ and TSS were both lower than the weekly and monthly average concentration

Table 2 - General Chemistry Results - Alderwood Water District - October 1992.

2MGD-2 grab 10/26 448294		17	25.5			18.0	7.3 365
2MGD-1 grab 10/26 448286		7	30.4			18.4	480
Eff-A* A-comp 10/26-27 448291	488 155 37.9 260 170	5 - −	26 15 81 24.7	17.2 0.02 3.03		<u>თ</u>	7.8 420
2MGD E-comp 10/26-27 448284	486 156 38.8 251 162	25 E T	30 19 78 37.2	17.4 0.11 3.41		თ <i>ბ</i> i	76 480
Inf-A A-comp 10/26-27 448283	576 178 47.4 608 239	310 	297 210 480 125	21 0.02 9.74		17.7	7.7 490
Inf-2 grab 10/27 448282		225	79.1		21.7	18.2	345
Inf-1 grab 10/26 448281		156	7		20e J	18.2	465
Inf-E E-comp 10/26-27 448280	545 175 43.6 598 211	282 1 U	316 210 470 102	22.8 1.35 8.24		හ හ	7.7 490
Location: Type: Date:	EMISTRY mhos/cm) ., CaCO3) L, CaCO3) g/L) glds (mc/l)	roan morror concerting. Total Suspended Solids (mg/L) W.Suspended Solids (mg/L) % Solids % Volatile Solids DXYGEN DEMAND	_) 9/L) ight)	ng/L)	ME (#/100 ml) MF (#/100 ml) MF (#/100 ml) (%) gravel (+10 mesh) sand (20-230 mesh) silt (4-8 phi) Clay (9-10 phi)) (0)	mhos/om)
Parameter	GENERAL CHEMISTRY Conductivity (umbos/cm) Alkalinity (mg/L, CaCO3) Hardness (mg/L, CaCO3) Total Solids (mg/L) Total NorVol Solids (mg/L)	Total Suspended Solids (mg/L) NV-Suspended Solids (mg/L) % Solids % Volatile Solids OXYGEN DEMAND	BOD5 (mg/L) BOD INH (mg/L) COD (mg/L) TOC (water)(mg/L) TOC (% dry weight) NI JTRIENTS	NH3-N (mg/L) NO2+NO3-N (mg/L) Total-P (mg/L)	Grain Size (%) Grain Size (%) Grain Size (%) gravel (+10 mesh) sand (20-230 mes silt (4-8 phi) clay (9-10 phi) FIFI D ORSERVATIONS	Temperature (C) Temp-cooled (C)+	pH (SU) Conductivity (umhos/cm) Chlorine (mg/L) Free Total

E-comp A-comp

+ ⊃ ¬

Ecology composite sample.
Alderwood Water District sample.
Alderwood Water District sample.
Alderwood effluent sampler failed. Sample was collected from Alderwood's 2MGD unit compositor.
Temperature of the sample collected with an iced or refrigerated composite sampler.
The analyte was not detected at or above the reported result.
The analyte was positively identified. The associated numerical result is an estimate.

Table 2 - General Chemistry Results (cont.) - Alderwood Water District - October 1992.

Eff-2 grab 10/27 448290	o	22.8	O T	18.5	7.3 435 0.8 0.8
Eff-1 grab 10/26 448289	286 286 172 27 27 1 U		. t	18.1	7.3 <0.1 1.5
Eff-BA g-comp 10/26 448296	40.5				
Eff-ED E-comp 10/27 448292	283 157 9 9	21.7	14.4 2.05 3.86		3.0 7.5 450
Eff-E E-comp 10/26-27 448288	473 135 135 38.1 322 179 1	20 15 15 23 23	14.5 2.06 3.61		3.0 7.5 450
1MGD-2 grab 10/26 448295	4	17.2		19.0	7.1 385
1MGD-1 grab 10/26 448287	7	27.4		19.3	7.4 435
1MGD E-comp 10/26-27 448285	412 97.6 40.2 246 167 7	23 10 17.8 7.8	6.89 5.47 3.94 4.04		6.7.74 6.4.70
Location: Type: Date: Lab Log #:	EMISTRY mhos/cm) CaCO3) CaCO3) g/L) olids (mg/L) sd Solids (mg/L) Solids (mg/L)	AND -) g/L) ight)	ng/L))US (water)(mg/L) (#/100 ml)	gravel (+10 mesh) sand (20-230 mesh) silt (4-8 phi) clay (9-10 phi) SERVATIONS	D)+ mhos/cm)
Parameter II	GENERAL CHEMISTRY Conductivity (umhos/cm) Alkalinity (mg/L, CaCO3) Hardness (mg/L, CaCO3) Total Solids (mg/L) Total NonVol Solids (mg/L) Total Suspended Solids (mg/L) % Solids % Volatile Solids	OXYGEN DEMAND BOD5 (mg/L) BOD INH (mg/L) COD (mg/L) TOC (water) (mg/L) TOC (% dry weight) NUTRIENTS	NH3-N (mg/L) NO2+NO3-N (mg/L) Total-P (mg/L) MISCELLANEOUS Oil and Grease (water)(mg/L) F-Coliform MF (#/100 ml) Grain Size	gravel (+10 me sand (20-230 r silt (4-8 phi) clay (9-10 phi) FIELD OBSERVATIONS Temperature (C)	Temp-cooled (C)+ pH (SU) Conductivity (umhos/cm) Chlorine (mg/L) Free Total

E-comp g-comp

Ecology composite sample.
Ecology grab composite of two equal volumes.
Temperature of the sample collected with an iced or refrigerated composite sampler.
The analyte was not detected at or above the reported result.
The analyte was positively identified. The associated numerical result is an estimate.

Table 2 - General Chemistry Results (cont.) - Alderwood Water District - October 1992.

Sedmt-2 grab 11/12 448298		L C F	1.05		Ç	9 - - - -				0	26	 c	7					
Sedmt-1 grab 11/12 448297		c c	82.2 2.45		C	N N				24	72	on c	V					
EffFColi grab 10/27 448302									8					17.8	7.4		0.5	0.5
Super grab 10/26 448301		940		527	360													
Eff-1A grab 10/26 448300		13			22.2				7					19.0	7.5	460	<0.1	1.25
Sludge grab 10/26 448293		ć	21 80.9		Ç	ν Σ												
Location: Type: Date: Lab Log #:	MISTRY hos/cm) CaCO3)	/L) lids (mg/L) d Solids (mg/L) Solids (mg/L)	Q		(L)		9/L)	Sr	water)(mg/L) #/100 ml)	gravel (+10 mesh)	sand (20-230 mesh)	silt (4-8 phi)	9-10 pni) ATIONS		+	ihos/cm)		
Parameter III	GENERAL CHEMISTRY Conductivity (umhos/cm) Alkalinity (mg/L, CaCO3) Hardness (mg/L, CaCO3)	rotal solids (mg/L) Total NonVol Solids (mg/L) Total Suspended Solids (mg/L) NV-Suspended Solids (mg/L)	% Solids % Volatile Solids OXYGEN DEMAND	BOD5 (mg/L) BOD INH (mg/L) COD (mg/l)	TOC (water) (mg/	NUTRIENTS	NH3-N (mg/L) NO2+NO3-N (mg	Total-P (mg/L) MISCELLANEOUS	Oil and Grease (water)(mg/L F-Coliform MF (#/100 ml)	Grain Size grave	sand	silt (4	FIELD OBSERVATIONS	Temperature (C)	PH (SU)	Conductivity (umhos/cm)	Cilidane (mg/L) Free	Total
									1	Λ								

Temperature of the sample collected with an iced or refrigerated composite sampler. The analyte was not detected at or above the reported result. The analyte was positively identified. The associated numerical result is an estimate. + ⊃ ¬

Table 3 - NPDES Effluent Limitation/Ecology Inspection Data Comparison - Alderwood Water District - October 1992.

	NPDES Permit Limitations Monthly Average	ns Weekly Average	Location: Inf-E Type: E-con Date: 10/26 Lab Log #: 44828	Inf-E E-comp 10/26-27 448280	Eff-E E-comp 10/26-27 448288	Eff-ED E-comp 10/26-27 448292	Eff-1 grab 9/27 448289	Eff-2 grab 9/27 448290	Eff-1A grab 9/26 448300	EffFColi grab 9/27 448302
5 Day Biological Oxygen 30 mg/L Demand 750 lbs/day	30 mg/L 750 lbs/day 85% removal	45 mg/L 1125 lbs/day		316 mg/L 5,401 lbs/day	20 mg/L tay 342 lbs/day 93.7% removal	8				
Snios pepuded Solids	30 mg/L 750 lbs/day 85% removal	45 mg/L 1125 lbs/day		282 mg/L 12 mg/L 4,820 bs/day 205 bs/day 95.7% removal	12 mg/L 205 lbs/day 95.7% remov	9 mg/L al	27 mg/L	27 mg/L 13 mg/L	13 mg/L	
Fecal Coliform Bacteria 200/100mL	200/100mL/200/200/200/200/200/	400/100mL						9/100mL		18/100mL
H d .	Shall not be outside the range of 6.0 - 9.0	5.0 - 9.0					7.3	7.3	7.5	7.4

limits specified in the permit. Based on the Alderwood influent flow totalizer reading of 2.05 MGD (Wheaton, personal communication), the loading to Puget Sound was 342 pounds of BOD₅ and 205 pounds of TSS per day. Both of these loading rates were less than the weekly and monthly averages specified in the permit.

The influent BOD₅ loading of 5400 lbs/day exceeded the design criteria of 5000 lbs/day specified in the permit. The influent TSS loading of 4820 lbs/day was just under the design criteria of 5000 lbs/day. The treatment plant was exceeding the minimum 85% removal efficiency for BOD₅ and TSS as specified in the permit. However, it should be noted that the filtrate from the sludge belt press is reintroduced to the influent upstream of both the Alderwood and Ecology influent sampling locations. This artificially elevates the influent BOD₅ loading and removal efficiency calculations.

The fecal coliform bacteria counts from the two Ecology grab samples were 9 and 18/100 mL. These are substantially less than the 200/100 mL and 400/100 mL monthly and weekly averages respectively specified in the permit. The total residual chlorine was fairly high (0.5-1.5 mg/L). The operator should see if acceptable coliform concentrations can be achieved with lower total residual chlorine concentrations.

The pH of the discharge was within the permit limitation of within 6.0 - 9.0.

The flow into the plant at the time of the inspection was approximately 2.05 MGD. This is less than the Design Annual Average Daily Flow Rate of 3.0 MGD specified in their permit.

Split Sample Analyses

The comparison of Alderwood and Ecology samples analyzed by the Manchester Laboratory was good. This indicates that the sampling was representative. Note: Alderwood composite samples were not adequately cooled during collection.

A comparison of samples analyzed by the Alderwood and the Manchester Laboratories indicates that the Alderwood BOD₅ and TSS results are consistently reported high relative to the Ecology results. However, it should be noted that the variability seen is within an acceptable range for those parameters. The fecal coliform results varied. Ecology's result was 18/100ml while Alderwood did not detect any colonies.

Table 4 presents the results of the Alderwood and Ecology split samples in tabular form.

Priority Pollutant Organics - VOA, BNA and Pesticide/PCB Scans

There were 14 VOA and BNA target analytes detected in the Alderwood wastewater (Table 5). Only six were detected in the effluent. However, all six compounds were less than the USEPA acute and chronic water quality toxicity criteria for saltwater (USEPA, 1986).

Table 4 - Split Sample Results Comparison - Alderwood Water District, October 1992.

Location: Inf-E Type: E-comp Date: 10/26-27 Lab Log #: 448280 Sampler: Ecology			316 (mg/L) Ecology 316 (mg/L) Alderwood 350	H (S.U.) Alderwood -Coliform MF (#/100 mL) Ecology Alderwood Alderwood
Inf-A A-comp 10/26-27 448283 Alderwood		310 310	297 340	
2MGD E-comp 10/26-27 448284 Ecology		30 30	34 34	
Eff-A* A-comp 10/26-27 448291 Alderwood		16 27	28 21	
1MGD E-comp 10/26-27 448285 Ecology	;	20	23 31	
Eff-E E-comp 10/26-27 448288 Ecology		1 12	30	
Eff-ED E-comp 10/26-27 448292 Ecology		ବ ଧ	29	
grab 10/27 448302 Ecology				7.4 7.1 18

Alderwood effluent sampler failed. Sample was collected from Alderwood's 2MGD unit compositor.

992.
8
_
ě
ctop
ö
Ÿ
ರ
并
쯢
16
ate
≥
g
W00
_
Nde
⋖
Ś
ults
es
α
ä
တ္တ
<u>s</u>
sta
$\stackrel{\circ}{\mathbb{Z}}$
ᄝ
an
ŭ
/PCB
0
믔
esticid
Pe
ئر
ž
ā
Š
9
-
Ŋ
음
Table 5
1

Jarv	(inc.	ater nic	ν_	50 *(a) 50 •		()	3.4 *(1)	3.4 *(0) 3.4 *(0)		36		60 60	25 25 3	86 86
EPA Water Quality Criteria Summary		Saltwater Chronic	Ng/L	6,400 450 5,000		(ng/L)				0.0036			5.6 0.025 8.3	
lity Crite														
er Qua	i i	_		(e) * * *	£.			jebj						
A Wat		Saltwater Acute	ng/L	12,000 10,200 6,300	1,970	(ng/L)	4,850 2.944	2.944 2.944 1,970		0.16		84	2.9 140 2.1 7.5	2.3 95
ш	İ	Sa												
αi							7000) D D				⊃		z
199	doe	rab /26 293	ug/kg))));	320 51 J		4300 L D D D	15000			ρ̈́		398 266 1.03	
ber,	Sludge	grab 10/26 448293) D				र्चे	15(mg/Kg-dr	6 /-	- 1011 - 6) (c)
Octo				D7DD:) 7						_			
<u>-</u> ਹ	Eff-1A	grab 10/26 448300	ng/L		- 44									
Distri	ũ	L \$4												
ater I				7722:										
χ̈́	Fff-2	grab 10/27 448290	ng/L	~ 0	4									
WOO		4												
ılder	ш	101/0					בככככ))) 은		≥ ⊃		222	44) Z ⊃ ⊃ Ξ	
- S	F#-F	comp 10/27 448288	ng/L							0.067			14 5.4	2.3 45.6
esult		Ĭ												
E R	?	827 gB	ng/L	4/4/11	ω - ⊃⊃⊃									
Scs	2	grab 10/27 448282	Š											
etals					¬ ⊃ ¬									
Σ	Inf-1	grab 10/26 48281	ng/L	80-41	~ α									
Ваг	_	grab 10/26 448281												
9/PC							⊃ ¬¬ =	o		33		ココロニ		כי
ticide	T-f-	comp 10/27 448280	J/6n				32 +	53 16		0.078		4.5	33.6 10.9 0.29	38.4 86.3
Pes		<u>, t</u> 4												
Ä,	i.	Type: Date: Log#:	,					ate	spuur					
A, E	l ocation.	Type Date: Lab Log#	10	o	ene	(r	ate	alate Phtha ene	одшо	ndane				
- VC			ponnoc	, sethen	obenz obenz	ounds	nenol nenol ohenol Phthal	1 Phth hexyl) obenz	OB C	크 오.				
Table 5 - VOA, BNA, Pesticide/PCB and Metals Scan Results - Alderwood Water District - October, 1992.			VOA Compounds	Acetone Chloroform Tetrachloroethene Toluene	Fotal Xylenes 1,2-Dichlorobenzene 1,4-Dichlorobenzene	BNA Compounds	2-Methylphenol 4-Methylphenol 2,4-Dinitrophenol Di-n-Butyl Phthalate	Pyrene Butylbenzyl Phthalate Bis(2-Ethylhexyl)Phthalate 1,2-Dichlorobenzene	Pesticide/PCB Compounnds	Gamma-BHC (Lindane) Heptachlor	** SI	Arsenic Beryllium Cadmium	alling t 30er sury	Selenium Silver Zinc
Tab			VOA	Acetone Chlorofo Tetrachle Toluene	10ta 1,2-1	BNA	2.4-K	Pyrene Butylbe Bis(2-El	Pest	Gam Hept	Metals**	Arsenic Berylliur Cadmiu	Copper Copper Lead Mercury	Selenii Silver Zinc

Table 5 - VOA, BNA, Pesticide/PCB and Metals Scan Results (cont.) - Alderwood Water District - October, 1992.

Ecology Sediment Management Standards

	Marine Sediment Quality Standards Chemical Criteria	mg/Kg TOC		mg/Kg-dry	57	260 390 450 0.41	6.1 410
	Ма						
Sedmt-2	grab 11/12 448298	m Bu	J	mg/Kg-dry	2.11 0.12 P U	16 3.13 B 4.7 P PJ 0.011 PJ 14.3	U D D D D D D D D D D D D D D D D D D D
Ŵ	grab 11/12 448297	mg/Kg-TOC	200 J	mg/Kg-dry	2.77 0.13 0.36	24.2 5.39 8.97 0.013 27.9	0.31 PN 35
Location:	Type: Date: Lab Log#:		Pyrene	Metals**	Arsenic Beryllum Cadmium	Chromium Copper Lead Mercury Nickel	Selenium Silver Zinc

NOTE: SOME INDIVIDUAL COMPOUND CRITERIA OR LOELS MAY NOT AGREE WITH GROUP CRITERIA OR LOELS. REFER TO APPROPRIATE EPA DOCUMENT ON AMBIENT WATER QUALITY CRITERIA FOR FULL DISSCUSSION.

The analyte was detected above the instrument detection limit but below the established minimum quantification limit The analyte was not detected at or above the reported result.

For metals analytes the spike sample recovery is not within control limits. For organic analytes there is evidence the analyte is present in this sam

The analyte was detected in the analytical method blank, indicating the sample may have been contaminated.

The analyte was positively identified. The associated numerical result is an estimate.

Insufficient data to develop criteria. Value presented is the LOEL - Lowest Observed Effect Level.

Results are reported as total metals for Hg in the water samples, and for sludge and sediment samples. Results are reported as total metals for the remaining metal in the water samples. Hardness dependent criteria (100 mg/L used). 17207 + 4 4 F ... - C

Total Halomethanes

Total Dichlorobenzenes

Total Phthalate Esters

Total Polynuclear Aromatic Hydrocarbons Total Nitrophenols

Four VOA and BNA compounds were detected in the sludge sample (Table 5). Bis(2-ethylhexyl)phthalate was detected in the highest concentration, yet lower than the USEPA National Sewage Sludge Survey (USEPA, 1990).

A complete list of priority pollutant compounds and their respective detection limits is provided in Appendix D. Tentatively identified compounds detected are provided in Appendix E.

Priority Pollutant Inorganics - Metals Scans

A number of priority pollutant metals were present in the influent. Four were detected in the effluent (Table 5). Of these, the copper concentration slightly exceeded the USEPA acute water quality toxicity criteria for saltwater. Silver and lead concentrations approximated acute and chronic criterias, respectively. The general trend was a decrease in concentration across the treatment works.

All priority pollutant metals except beryllium were detected in the sludge. The metals were present in concentrations less than the geometric mean plus one standard deviation identified in the USEPA National Sewage Sludge Survey (Table 6) (USEPA, 1990).

Bioassays

The bioassay results demonstrated slight effluent toxicity (Table 7). The sample collected for bioassay testing was dechlorinated at the laboratory.

The rainbow trout (*Oncorhynchus mykiss*) static acute toxicity test, *Daphnia pulex* 48 hour survival test, and *Ceriodaphnia dubia* chronic renewal toxicity test yielded LC₅₀s and NOECs greater than or equal to 100% effluent.

The fathead minnow (*Pimephales promelas*) chronic renewal toxicity test also yielded an LC₅₀ greater than 100% effluent. However, the NOEC for growth and survival were 50% and 6.25% effluent, respectively.

Sediments

The grain size distribution for the two sediment samples was different. The outfall sample was 24% gravel while the background sample was nearly pure sand. Percent solids, percent volatile solids and TOC were similar (Table 2).

Only one organic priority pollutant compound was detected in the sediments analyzed. The compound was the polynuclear aromatic hydrocarbon pyrene detected at an estimated concentration of 400 ug/Kg dry-weight (200 mg/kg TOC) in the outfall sample. The compound was not detected in the influent, effluent or sludge samples. All priority pollutant metals detected were found at slightly higher concentrations in the outfall sample than the background

Table 6 - Comparison of Compounds in Sludge with the National Sewer Sludge Survey - Alderwood Water District - October 1992.

			Data from EPA Sludge Survey (USEPA, 1990)	A Sludge Su	ırvey (USEI	^A, 1990
Parameter	Location: Sludge	Geometric	Geometric	Coefficient	Number of	Percent
	Type: grab	Mean **	Mean + 1 S.D.	of Variation	Samples	Detected
	Date: 10/26					
	Lab Log # 448293					
	mg/Kg-dry	mg/Kg-dry	mg/Kg-dry			%
BNA COMPOUNDS						
Bis(2-ethythexyl) Phthalate	125	74.7	673	8.01	200	62
<u>METALS</u>						
Arsenic	3.28	600	28.7	6,1	199	80
Cadmium	76.7	6.9	18.7	1.7	198	69
Chromium	16.8	118.6	458	2.9	199	6
Copper	398.0	741.0	1703	1.3	199	100
Lead	266.0	134.0	332	1,5	199	8
Mercury	1.03	5.22	20.8	2.98	199	63
Nickel	37.4	42.7	137.5	2.2	199	99
Selenium	3.77	5.16	12.5	1,42	199	99
Zinc	442.0	1202	2756	<u>,</u>	199	8

The analyte was positively identified. The associated numerical result is an estimate. In general, concentrations are a weighted combination of flow rate group estimates. つ ‡

Table 7 - Effluent Bioassay Results - Alderwood Water District - October 1992.

NOTE: All tests were run on the effluent (Eff-BA sample) - lab log # 448296

Ceriodaphnia dubia - Chronic Renewal Toxicity Test

		Percent	Mean # Young per
Sample	# Tested *	Survival	Original Female
Control	10	06	17.9
6.25 % Effluent	10	70	11.6
12.5 % Effluent	10	80	14.3
25 % Effluent	10	06	22.6
50 % Effluent	10	06	19.7
100 % Effluent	10	80	13.1

^{* 10} replicates of 1 organism

LC50 = > 100% Effluent NOEC for survival = 100 % Effluent NOEC for reproduction = 100 % Effluent

Fathead Minnow (Pimephales promelas) - Chronic Renewal Toxicity Test

Sample	# Tested *	Percent Survival	Mean dry weight of organisms (mg)
Control	30	97.1	0.7
6.25 % Effluent	30	97.1	0.63
12.5 % Effluent	30	97.1	9.0
25 % Effluent	30	100	0.58
50 % Effluent	30	94.3	0.46
100 % Effluent	30	71.4	0.27

^{* 3} replicates of 10 organisms

LC50 = >100 % Effluent NOEC for survival = 50 % Effluent NOEC for growth = 6.25% Effluent

Table 7 (cont.) - Effluent Bioassay Results - Alderwood Water District - October 1992.

Rainbow Trout (Oncorhynchus mykiss) - Static Acute Toxicity Test

Percent Survival	06 63
#Tested*	30
Sample	Control 100% Effluent

* 3 replicates of 10 organisms

LC50 = >100 % Effluent

Daphnia pulex - 48 Hour Survival Test

# Tested * Survival	20	20	20	20	20	20
Sample	Control	6.25 % Effluent	12.5 % Effluent	25 % Effluent	50 % Effluent	100% Effluent

* 4 replicates of 5 organisms

LC50 = >100 % Effluent NOEC = 100 Effluent NOEC - no observable effects concentration LOEC - lowest observable effects concentration LC50 - lethal concentration for 50% of the organisms EC50 · effect concentration for 50% of the organisms sample (Table 5). The concentrations of inorganics were one to two orders of magnitude less than the Washington State Department of Ecology Marine Sediment Quality Standards, Chemical Criteria (Ecology, 1991). The concentration of pyrene was one-fifth the sediment standard.

The sediment bioassay results document that the sediments tested were not toxic to either the *Rhepoxynius abronius* or Microtox test organisms (Table 8).

RECOMMENDATIONS AND CONCLUSIONS

Flow Measurements

Influent flows were measured at the flumes to the 1MGD and 2MGD units. Flows were verified as acceptable when compared to Alderwood's flow meters.

Quality Assurance/Quality Control

All samples were received by the Manchester Laboratory with chain-of-custody maintained. All samples were extracted and/or analyzed within the USEPA method holding times specified for each parameter. Manchester Laboratory QA/QC were deemed acceptable by the Manchester quality assurance personnel.

The Ecology Quality Assurance Section conducted a system audit of the Alderwood Laboratory capabilities in conjunction with this Class II Inspection. As a result of this system audit, the Alderwood Laboratory has received Laboratory Accreditation.

General Chemistry

The Alderwood treatment plant provided good treatment for the solids and oxygen demand parameters. The 1MGD unit appeared to provide slightly better treatment than the 2MGD unit. The 1MGD unit was partially nitrifying while the 2MGD unit was not nitrifying. The operator indicated the 2MGD unit aeration system was less efficient; a likely explanation for the observed differences. Methods to improve aeration should be investigated.

NPDES Permit Compliance

Compliance with the effluent limitations of the permit was good. BOD₅ and TSS were treated below both the weekly and monthly averages specified in the permit and exceeded the minimum 85% removal efficiency required in the permit. The discharge was within the acceptable pH range.

The influent BOD₅ loading exceeded the design capacity and TSS loading approximated the design capacity. The degree to which the sludge press filtrate return flow contributes to the

Table 8 - Sediment Bioassay Results - Alderwood Water District - October 1992.

Amphipod (Rhepoxynius abronius) - 10 Day Survival Test

Sample	# Tested *	Percent Survival	Percent Mortality per Survival Replicate +	Total Emergence Events per Replicate ±	Failure to <u>Rebury</u>
Control	100	86	0.4 (+/- 0.5)	1.0(+/- 1.4)	0.4 (+/- 0.5)
Sedmt-1 (Sample #448297) Outfall	100	96	0.8 (+/- 0.8)	5.2(+/- 6.3)	1.6 (+/- 1.1)
Sedmt-2 (Sample #448298) Background	100	66	0.2 (+/- 0.4)	0.8(+/- 1.1)	0.2 (+/- 0.4)

^{*} five replicates of 20 organisms + mean (standard deviation)

Microtox - Toxicity Test *

EC50 = >100% Sediment

* 2 replicates each, conducted on samples #448297 and #448298

NOEC - no observable effects concentration LOEC - lowest observable effects concentration LC50 - lethal concentration for 50% of the organisms EC50 - effect concentration for 50% of the organisms

influent loadings is not known. However, the new Metro North Creek trunk line should reduce the influent loadings when completed. The feasibility of relocating the influent sample station upstream of the filtrate return should be investigated.

The influent flow was approximately 66% of the annual average daily flow rate specified in the permit.

The discharge was adequately disinfected. However, the total residual chlorine concentrations should be reduced to the lowest level capable of controlling fecal coliform bacteria.

Split Sample Analyses

The split sample results indicated that Alderwood was collecting representative samples. Alderwood analyses of BOD₅ and TSS were generally higher than the corresponding Ecology analyses but within an acceptable range for those parameters. The causes for these discrepancies should be explored. Additionally, provisions should be made to ensure that influent sample, collected by Alderwood, are cooled to 4° C.

Priority Pollutants

A number of priority pollutants were detected in the wastewater. Only the effluent copper concentration exceeded the USEPA Acute Water Quality Toxicity Criteria for saltwater.

The sludge also contained a number of priority pollutants. All were at concentrations less than the average concentrations reported in the USEPA sewer sludge survey.

Bioassays

The bioassay results demonstrated slight effluent toxicity. The fathead minnow (*Pimephales promelas*) showed a limited toxic response to the effluent. The chronic renewal toxicity test yielded an NOEC for survival and growth at 50% and 6.25% effluent respectively.

Sediments

Few target analytes were detected in the sediment priority pollutant scans. All were less than Washington State's Sediment Management Standards.

The sediments demonstrated no significant toxicity to bioassay test organisms.

REFERENCES

- Ecology, 1991. Sediment Management Standards. Chapter 173-204 WAC.
- USEPA, 1986. Quality Criteria for Water. U.S. Environmental Protection Agency, EPA 440/5-86-001, 1986.
- USEPA, 1990. <u>Federal Register, National Sewage Sludge Survey</u>, Vol. 55, No. 218, 40 CFR Part 503. U.S. Environmental Protection Agency.
- Wheaton, L., 1993. Personal communication. Alderwood Water District.

APPENDIX

Appendix A - Ecology Sampling Schedule and Parameters Analyzed - Alderwood Water District - October 1992.

Parameter Loo Lab	cation: Type: Date: Log #:	Inf-E E-comp 10/26-27 448280	Inf-1 grab 10/26 448281	Inf-2 grab 10/26 448282	Inf-A A-comp 10/26-27 448283	1MGD-1 grab 10/26 448287	1MGD-2 grab 10/26 448295	1MGD E-comp 10/27 448285	2MGD-1 grab 10/26 448286	2MGD-2 grab 10/26 448294
ERAL CHEMIS fuctivity inity ness n Size IDS 4										
TSS % Solids % Volatile Solids OXYGEN DEMAND BOD5 BOD INH			- 200			-	→	-	• ************************************	
COD TOC (water) TOC (soil/sed) NUTRIENTS NH3-N NO2+NO3-N					**************************************	**************************************				
Total-P MISCELLANEOUS Oil and Grease (water) F-Coliform MF ORGANICS										
VOC (soil/sed) BNAs (water) BNAs (soil/sed) Pest/PCB (water) Pest/PCB (soil/sed)										
METALS METALS PP Metals (water) PP Metals (soil/sed) BIOASSAYS Salmonid (acute 100%) Microrox (acute)										
Ceriodagnia (chronic) Eathead Minnow (chronic) Rhepoxinius (solid acute) Microtox (solid acute) FIELD OBSERVATIONS*	(i) (e) *50									

E-comp A-comp

Ecology com[posite sample.
Alderwood composite sample.
Temperature, pH and conductivity were measured on all water samples collected except the grab-composite # 448296.
Free and total chlorine were measured on all effluent grab samples.

Appendix A - Ecology Sampling Schedule and Parameters Analyzed (cont.) - Alderwood Water District - October 1992.

Eff-ED Eff-A# E-comp A-comp 10/26-27 10/26-27 448292 448291			() () () () () () () () () (
Eff-E E-comp 10/26-27 448288					
EffFColi Eff-BA grab g-comp 10/27 10/26 448302 448296					
Eff-1A Eff-2 grab grab 10/26 10/27 448300 448290			~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~		
Eff-1 grab 10/27 448289					
Location: 2MGD Type: E-comp Date: 10/26-27 Lab Log #: 448284	<u>§</u>	9	JS water)	(p)	ed) 100%) rronic)
Parameter II	GENERAL CHEMISTRY Conductivity Alkalinity Hardness Grain Size SOLIDS 4 TSS % Solids	% Volatile Solids	NO2+NO3-N Total-P MISCELLANEOUS Oil and Grease (water) F-Coliform MF ORGANICS VOC (water)	BNAs (water) BNAs (water) BNAs (soil/sed) Pest/PCB (water) Pest/PCB (soil/sed)	ME I ALS PP Metals (water) PP Metals (soil/sed) BIOASSAYS Salmonid (acute 100%) Microtox (acute) Ceriodaphiia (chronic)

E-comp A-comp g-comp

Ecology composite sample.
Alderwood composite sample.
Ecology grab-composite sample.
Alderwood effluent sample failed. Sample was collected from Alderwood's 2MGD unit compositor.
Alderwood effluent sampler failed. Sample was collected from Alderwood's 2MGD unit compositor.
Temperature, pH and conductivity were measured on all water samples collected except the grab-composite # 448296.
Free and total chlorine were measured on all effluent grab samples.

Appendix A - Ecology Sampling Schedule and Parameters Analyzed (cont.) - Alderwood Water District - October 1992.

ପ ପୁ ପୂ ଷ୍ଟ							i u pacti Santiariti
Sedmt-2 grab 10/29 448298							
Sedmt-1 grab 10/29 448297		77 77					
Super grab 10/26 4482301							
Sludge grab 10/26 448293							
Location: Type: Date:	IISTRY	9		S (zeler)	(p)	(%00)	ronic) (chronic) d acute) ute) TIONS
Parameter III	GENERAL CHEMISTR Conductivity Alkalinity Hardness Grain Size	TSS % Solids % Volatile Solids % Volatile Solids OXYGEN DEMAND BOD5	TOC (water) TOC (soil/sed) NUTRIENTS NH3-N NO2+NO3-N	lotal-P MISCELLANEOUS Oil and Grease (water) F-Coliform MF ORGANICS VOC (water)	VOC (soil/sed) BNAs (water) BNAs (soil/sed) Pest/PCB (water) Pest/PCB (soil/sed) Herbicides (water)	ME I ALS PP Metals (water) PP Metals (soil/sed) BIOASSAYS Salmonid (acute 100%) Microtox (acute)	Ceriodaphnia (chronic) Fathead Minnow (chronic) Rhepoxinius (solid acute) Microtox (solid acute) FIELD OBSERVATIONS

Temperature, pH and conductivity were measured on all water samples collected except the grab-composite # 448296. Free and total chlorine were measured on all effluent grab samples.

Appendix A-1 - Ecology Analytical Methods and Laboratories Used - Alderwood Water District - October 1992.

Laboratory	Manchester Laboratory Weyerhauser Analytical Testing Service Manchester Laboratory Manchester Laboratory Manchester Laboratory Manchester Laboratory Manchester Laboratory Manchester Laboratory Weyerhauser Analytical Testing Service Pacific Environmental Laboratory Weyerhauser Analytical Testing Service Pacific Environmental Laboratory Manchester Laboratory
Method	EPA Method 120.1 EPA Method 310.1 EPA-130.2 Puget Sound Protocol EPA Method 160.3 SM 2540E EPA Method 160.4 SM 2540G SM 2540G SM 2540G EPA Method 405.1 SM-17 5210 EPA Method 405.1 SM-17 5210 EPA Method 410.1 EPA Method 410.1 EPA Method 350.1 EPA Method 355.1 EPA Method 350.1 EPA Method 350.1 EPA Method 350.1 EPA Method 8200 EPA Method 8200 EPA Method 8200 EPA Method 8200 EPA Method 8080 EPA Method 200 Beckman, 1982
Parameter	Conductivity Alkalinity Hardness Grain Size TNVS TSS TNVS TSS TNVSS TNVS TVS TVS TVS TVS TVS TVS TVS TVS TVS T

Appendix B

Priority Pollutant Cleaning Methodology

- Wash with laboratory grade detergent (Liqui-Nox). Rinse several times with tap water. 1.
- 2.
- Rinse with 10% nitric acid solution. 3.
- Rinse three (3) times with distilled/deionized water. 4.
- Rinse with reagent-grade methylene chloride. 5.
- Rinse with reagent-grade acetone. 6.
- Allow to air dry and seal with aluminum foil. 7.

The priority pollutant cleaning methodology was altered for the cleaning of the sediment collection equipment used for sediment samples #448297 and #448298. The use of the methylene chloride rinse was replaced with a methanol rinse.

Appendix C

STATE OF WASHINGTON

DEPARTMENT OF ECOLOGY

Post Office Box 488 • Manchester, Washington 98353-0488 • (206) 895-4649

October 29, 1992

Mr. Roger C. Gorham Alderwood Wastewater Treatment Plant 6315 Picnic Point Rd Edmonds, WA 98026

Dear Mr. Gorham:

I am pleased to inform you that the Alderwood Wastewater Treatment Plant Laboratory has met all requirements for accreditation under the provisions of Chapter 173-50, Washington Administrative Code. A report of the system audit conducted on October 27, 1992 is enclosed. Also enclosed is the lab's Certificate and Scope of Accreditation.

As noted in the system audit report, a number of recommendations were made for improving laboratory operations. Please keep us informed of any changes made to your quality assurance program including those made to implement any of recommendations in the audit report.

To maintain accreditation status, the lab must: report significant equipment and personnel changes as they occur; submit any updates of the lab's QA manual; submit results of performance evaluation sample analyses semiannually (e.g., one DMR-QA Study, one WP Study); and submit a new application and appropriate fees annually.

Thank you for joining our Environmental Laboratory Accreditation Program in such a timely manner. My staff is available to assist in matters concerning the lab's quality assurance program. Please contact us if you think we can help.

Sincerely,

Steward M. Soulers for CTIC Cliff J. Kirchmer, Manager Quality Assurance Section

CJK:DJ:dj Encls:

1. Certificate

2. Scope of Accreditation

3. On-site Audit Report

WASHINGTON STATE DEPARTMENT OF ECOLOGY ENVIRONMENTAL INVESTIGATIONS AND LABORATORY SERVICES QUALITY ASSURANCE SECTION

SYSTEM AUDIT REPORT

LABORATORY: Alderwood Wastewater Treatment Plant Laboratory

ADDRESS:

6315 Picnic Point Road

Edmonds, WA 98026

DATE OF AUDIT: October 27, 1992

AUDITORS:

Dale Van Donsel

Team Leader, Microbiology

Perry Brake

Admin, General Chemistry

PERSONNEL

Roger Gorham

Lab Technician, Operator II

INTERVIEWED:

LeRoy Wheaton

Senior Operator

AUTHENTICATION:

GENERAL FINDINGS AND RECOMMENDATIONS

A system audit was conducted at the Alderwood Wastewater Treatment Plant Laboratory on October 27, 1992 pursuant to Chapter 173-50-080, Washington Administrative Code. The purpose of the audit was to verify laboratory capabilities as stated in the application for accreditation and quality assurance manual (previously submitted by the laboratory in partial fulfillment of accreditation requirements), and to review analytical and quality control data. General audit findings and recommendations are documented below. Significant recommendations for improvement of laboratory operations are highlighted by use of italics.

1. Personnel

- a. Mr. Gorham is responsible for operation of the treatment plant lab and is the primary architect of the lab's quality assurance (QA) program and author of the QA manual. Mr. Wheaton usually does analyses in the morning and Mr. Gorham in the afternoon. One other individual assigned to the plant, and a fourth individual assigned to the Alderwood Water District who occasionally fills in at the WTP, also conduct analyses in the lab as required.
- b. Mr. Gorham meets minimum recommended requirements for training in lab operations for the parameters done in the lab. He was also very familiar with operation of the instruments used in the lab and demonstrated ability to follow applicable analytical methods. He and Mr. Wheaton both appeared eager to improve lab efficiency and effectiveness.

2. Facility

- a. The lab facility consists of one spacious room located in the treatment plant control building. Most administrative functions supporting lab operations (e.g., paperwork) are also done in the same room with an adjoining room used for some filing. There is sufficient space in the current lab to support limited expansion of analytical capabilities.
- b. Lab utilities (e.g., electricity, reagent grade water, safety shower), were evaluated and found satisfactory for current operations. There was no record to indicate a fume hood in which a muffle furnace, drying oven, and steam bath were located, had ever been checked for adequacy of air flow. A check was made by the visiting team and the flow found to be 120 linear feet per minute with the sash fully open which meets the ASTM-recommended flow of 75-125 FPM. A recommendation was made to have the hood checked for flow periodically (e.g., every year).

3. Equipment and Supplies

a. The lab is currently using a Corning "pH Meter 5" analog meter for pH determinations. The meter is not listed in current lab supply catalogs

- (e.g., VWR) and apparently is no longer in production. The meter is slow to respond and difficult to read accurately which complicates calibration and sample analysis. The analog dial can be read only to tenths of pH units, and then only with some uncertainty. To give the lab a capability to measure pH with greater precision and certainty and do so quicker (estimated time savings per day is 30 minutes), a recommendation was made to replace the marginally functional Corning instrument with a digital meter having automatic temperature compensation, and a probe with integral thermometer.
- b. A Wallace and Tiernan amperometric titrator was being used for residual chlorine determinations by the back titration method. While the amperometric titration methods give greater sensitivity than other methods (e.g., colorimetric), use of the amperometric titrator requires greater operator skill and a concerted preventative maintenance program to obtain reliably good results. Loss of chlorine can occur due to rapid stirring, and electrodes must be conditioned and cleaned frequently for sharp (and thus easily recognized) end points. To give the lab a capability to accurately analyze residual chlorine using a method which requires considerably less operator interpretation, is significantly quicker, and minimizes use of expensive and potentially hazardous reagents (e.g., PAO), a recommendation was made to purchase a colorimeter and use the much simpler DPD method of analysis. Relatively inexpensive colorimeters and prepackaged reagents are available which greatly simplify residual chlorine testing with little sacrifice in sensitivity (e.g., the Hach DR-100, \$235, or the Hach Pocket Colorimeter, approximately the same price).
- c. The thermometers being used for the BOD and fecal coliform incubators were neither NIST-certified nor traceable to an NIST-certified thermometer. The thermometers were calibrated against a NIST-certified thermometer provided by the audit team. Certificates are enclosed showing traceability to the certified thermometer. Although the fecal coliform thermometer is acceptable, it is very long and in a location where it is subject to breakage. A shorter one, such as the ERTCO coliform incubator thermometer (available from most suppliers) would be safer. Before another thermometer is put into use, it should be calibrated against the present one.
- d. An improper formulation was being used for preparation of the buffered dilution/rinse water for the fecal coliform test. Addition of magnesium chloride is necessary (see enclosed method). The stock phosphate component should be prepared in a clear container and refrigerated and discarded when turbidity develops. The distilled water used for preparation of the buffered water comes from a glass still that should produce an excellent quality water, but it was recommended that for buffered water preparation, water should be drawn directly from the still, avoiding the storage carboys. Even though these are cleaned regularly, bacterial growth can occur. Common organisms such as Pseudomonas are notorious for growing in stored water and producing toxic compounds that can interfere with microbiological test results. A more convenient alternative to preparation of the buffered water is to purchase it. This is available from most laboratory supply houses at very reasonable cost.

Alderwood Wastewater Treatment Plant Lab Audit Report Page 4 of 6

- e. Although Mr. Gorham is presently able to adequately monitor performance in the lab with presently available supplies and equipment, to do so is time consuming and laborious. Ready access to a personal computer with printer would save considerable time not only for monitoring performance (e.g., by automating the control charting process) but also for data and information recording related to all plant activities. Time saved could be spent on other priority tasks in the lab and plant.
- 4. <u>Sample Management</u>. Because of the nature of the treatment plant and lab, sample management appeared to present no significant problems. Samples are analyzed immediately after being taken. Chain-of-custody procedures, both administrative and physical, were reviewed during the audit and found satisfactory.
- 5. <u>Data Management and Records Keeping</u>. No significant deficiencies were noted with regard to data management or records keeping. A recommendation was made to add a space on the pH bench sheet for recording results of standard solution (i.e., a buffer solution other than the calibration buffers) analysis. This should be done when forms are next revised and, in the meantime, results should just be written somewhere on the present form.
- 6. <u>Performance Evaluation (PE) Samples</u>. The plant is not a major discharger, so it does not receive DMR-QA samples. Raw data for the most recent PE sample analyses (samples provided by the QA Section and from Analytical Products Group) were reviewed during the audit and found to be in order. Samples for pH, TSS, BOD, and residual chlorine were analyzed successfully. The lab had signed up for WP029 and was in the process of analyzing the samples.

7. Quality Assurance/Quality Control

- a. Prior to preparing for the laboratory accreditation program, the lab had relied upon infrequent analysis of PE samples as the only check on accuracy (with no check on precision). In addition to continuing the analysis of PE samples, the current QA program calls for analysis of pH, BOD, TSS, and residual chlorine check standards as a check on accuracy, and frequent analysis of both TSS and BOD duplicates as an additional check on precision. Sufficient data were available to evaluate the outcome of TSS duplicate and both BOD tests; each was "in-control" and meeting laboratory data quality objectives. Material for preparing the TSS standard had just been received and only one test had been run.
- (1) The lab should continue to analyze BOD standards (glucose/glutamic acid) and duplicates to provide maximum information on accuracy and precision. The BOD test is the most likely to experience problems and the more information that is available, the easier it will be to find and eliminate the source of the problems.
- (2) Once the TSS standard (cellulose suspension) is being analyzed successfully on a regular basis and precision is found to be good (as indicated by a small standard deviation), the lab should consider discontinuing analyzing duplicate TSS samples. Precision can be adequately monitored from the results of analyzing the standard suspension.

Alderwood Wastewater Treatment Plant Lab Audit Report Page 5 of 6

- (3) Precision of the residual chlorine test should be monitored by analyzing duplicate samples frequently and control charting the results. Accuracy can be monitored less frequently (perhaps quarterly) by analysis of a standard. The standard can be purchased (e.g., from Hach) or prepared in the lab.
- (4) Analysis of the third buffer frequently (e.g., weekly), and control charting the results, is sufficient to monitor accuracy and precision for the pH test.
- b. Environmental samples were not being stirred with a magnetic stirring bar during the pH determination. A recommendation was made to stir all environmental samples as required by the method. The importance of stirring can be easily demonstrated with a turbid sample by monitoring the pH of a stirred and unstirred sample. The unstirred sample pH will stabilize very slowly as the pH changes during settling of solids and will differ considerably from the pH of the stirred sample
- c. The laboratory is taking all the possible steps to optimize fecal coliform recovery with the membrane filter (M-FC) test. However, the test itself has some serious deficiencies when it is applied to chlorinated effluents. It is important that the lab establish its own credibility with this method. EPA Guidelines Establishing Test Procedures for the Analysis of Pollutants Under the Clean Water Act, 40 CFR Part 136, Table 1A, dated July 1, 1990 states, "Since the membrane filter technique usually yields low and variable recovery from chlorinated wastewaters, the MPN method will be required to resolve any controversies". The simplest approach for this lab is to do periodic sample splitting with another lab capable of doing the MPN method. This may be a laboratory accredited for this procedure by the Department of Ecology or certified by the Department of Health. Mr. Gorham is able to have this test done at the Lynnwood treatment plant lab which is accredited for it. Monthly comparisons would be acceptable, and if numbers compare well, sample splitting can be reduced to quarterly. The object of these comparisons is not to seek an exact comparison of numbers between the two methods, but to watch for MPN results significantly and consistently higher than the MF that would indicate failure to recover some organisms.
- d. Fecal coliform cultures are not decontaminated before being discarded. This is a source of potential criticism or liability for the laboratory. Fecal coliform colonies on the membranes are made up of very high numbers of living organisms (mostly Escherichia coli and Klebsiella pneumoniae) some types of which can cause human infection. Some of the "background" colonies on membranes may also be potential human pathogens. Autoclaving for a minimum of 30 minutes is normally required and a record should be maintained of decontamination runs. This will provide documentation that discarded cultures were decontaminated properly.

8. Methods

a. Current copies of the methods employed in the lab are present and readily available to analysts at bench level.

Alderwood Wastewater Treatment Plant Lab Audit Report Page 6 of 6

- b. The lab had requested accreditation for residual chlorine using Standard Method 4500-Cl G, a colorimetric DPD method used for process control determinations at the plant (using a color comparator). The method actually used in the lab for NPDES reporting is amperometric titration, SM 4500-Cl D, the method for which accreditation should be granted.
- c. At the time of the audit, the lab was judged capable of accurately analyzing for all parameters for which accreditation has been requested.

Encl: Thermometer Certificates
Fecal Coliform Procedure

SCOPE OF ACCREDITATION

The Alderwood Wastewater Treatment Plant Laboratory, Edmonds, Washington, is accredited by the State of Washington Department of Ecology to perform analyses for the parameters listed below using the indicated analytical methods as cited in Standard Methods for the Examination of Water and Wastewater, 17th edition. Accreditation for all parameters is final. This accreditation applies to water and water-related analyses only.

PARAMETER	METHOD		
pH	SM 4500 H+		
Biochemical Oxygen Demand (BOD)	SM 5210 B		
Total Suspended Solids	SM 2540 D		
Residual Chlorine	SM 4500-C1 D		
Fecal Coliforms	SM 9222 D		

AUTHENTICATION:

Cliff J. Kirchmer, Ph.D. Quality Assurance Officer

> October 28, 1993 Expiration date

Alderwood Wastewater Treatment Plant Lab Scope of Accreditation, Page 2 of 1

Parameters Denied accreditation

<u>Parameter</u>

Method

None

The State of Department (S) THE ALL STATES nothundsem!

This is to certify, Alberwood 脚astewater Creatment plant Aboratory Edmonds, Washington

located at

That

accompanying Scope of Accreditation. has complied with provisions set forth in Chapter 173-50 WAC and is hereby recognized by the Department of Ecology as an ACCREDITED LABORATORY for the analytical parameters listed on the

October	ctober	tificate is
19 93	1992 and shall expire on the	tificate is effective on the .
S	and	the
	shall ex	2917
	xpire	
	9	day of
	the .	Q,
	28th day	
	day	

9

This cer

Witnessed under my hand this

29th day of October

19_92

LAB ACCREDITATION NUMBER

M052

Cliff J. Kirchmer, Ph.D.

Quality Assurance Officer

Appendix D - VOA, BNA, Pesticide/PCB and Metals Scan Results - Alderwood Water District - October 1992.

Chloromethane Bromomethane Vinyl Chloride Chloroethane Methylene Chloride Acetone Carbon Disulfide 1,1-Dichloroethane 1,2-Dichloroethane 1,2-Dichloroethane 2-Butanone (MEK) 1,1,1-Trichloroethane 2,2-Dichloroethane 1,2-Dichloropropane cis-1,3-Dichloropropane is-1,3-Dichloroethane 1,2-Trichloroethane 1,1-2-Trichloroethane Eromotorm 4-Methyl-2-Pentanone (MIBK) 2-Hexanone Tetrachloroethene 1,1,2,2-Tetrachloroethane Total Xylenes 1,2-Dichlorobenzene Ethylbenzene Ethylbenzene Ethylbenzene 1,3-Dichlorobenzene 1,3-Dichlorobenzene 1,3-Dichlorobenzene	Location: Type: Date: Lab Log#: VOA Compounds	
	Inf-E comp 10/27/92 448280 ug/L	
	Inf-1 grab 10/26/92 448281 ug/L	
	Int-2 grab 10/26/92 448282 ug/L	
	Eff-E comp 10/27/92 448288 ug/L	
	Eff-2 grab 10/27/92 448290 ug/L	
56-55555555555555555555555555555555555	Eff-1A grab 10/27/92 448300 ug/L	
15000000000000000000000000000000000000	Sludge grab 10/26/92 448293 ug/kg-dr	
%%%%%%%%%%%%%%%%%%%%%%%%%%%%%%%%%%%%%%	Sedmt-1 grab 11/12/92 448297 ug/kg-dr	
CCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCC	Sedmt-2 grab 11/12/92 448298 ug/kg-dr	

Appendix D (cont.) - VOA, BNA, Pesticide/PCB and Metals Scan Results - Alderwood Water District - October 1992.

Phenol Bis(2-Chlorophenol 1,3-Dichlorobenzene 1,4-Dichlorobenzene Benzyl Alcohol 1,2-Dichlorobenzene 2-Methylphenol Bis(2-Chloroisopropyl)Ether 4-Methylphenol Bis(2-Chloroisopropyl)Ether 4-Methylphenol N-Nitroso-di-n-Propylamine Hexachloroethane Nitrobenzene Isophorone 2-Nitrophenol 2,4-Dimethylphenol Bis(2-Chloroethoxy)Methane 2-Nitrophenol 1,2,4-Trichlorobenzene Naphthalene 4-Chloro-3-Methylphenol 1,2-A-Dichlorophenol 1,2-A-Trichlorophenol 1,2-A-Trichlorophenol 1,2-Chloroaniline Hexachlorocyclopentadiene 4-Chloro-3-Methylphenol 2-Methylnaphthalene 2-1,5-Trichlorophenol 2-Chloronaphthene 2-1,5-Trichlorophenol 2-Chloronaphthene 2-1,6-Trichlorophenol 1-Chlorophenol 1-Chlorophenol 1-Chlorophenol 1-Chlorophenol 1-Chlorophenol 1-Nitrosodiphenyl Phenylether 1-Buryl Phthalate 4-Chlorophenyl Phenylether 1-Buryl Phthalate 4-Chlorophenyl Phenylether 1-Buryl Phthalate	Location: Type: Date: Lab Log#: BNA Compounds	Oppendix D (cont.) - V
	Inf-E comp 10/27/92 448280 ug/L	(2), (142), -
	Inf-1 grab 10/26/92 448281 ug/L	dollolde/1
	Int-2 grab 10/26/92 448282 ug/L	מות ועומ
	Eff-E comp 10/27/92 448288 ug/L	ctais ocair i
	Eff-2 grab 10/27/92 448290 ug/L	Teanita - Vi
	Eff-1A grab 10/27/92 448300 ug/L	idel Mood A
14000 U U U U U U U U U U U U U U U U U U	Sludge grab 10/26/92 448293 ug/kg	אמנפו טואנווני
	Sedmt-1 grab 11/12/92 448297 ug/kg-dr	כני- טכנטטפו
872 872 872 873 874 875 877 877 877 877 877 877 877	Sedmt-2 grab 11/12/92 448298 ug/kg-dr	1332.

Appendix D (cont.) - VOA, BNA, Pesticide/PCB and Metals Scan Results - Alderwood Water District - October 1992.

alpha-BHC beta-BHC gamma-BHC (Lindane) Heptachlor Epoxide Endosulfan I Dieldrin 4,4'-DDE Endin Endosulfan Sulfate 4,4'-DDT Methoxychlor Endrin Ketone alpha-Chlordane gamma-Chlordane Toxaphene Aroclor-1212 Aroclor-1222 Aroclor-1232 Aroclor-1242 Aroclor-1248 Aroclor-1256 Endrin Aldehyde	Benzo(a)Anthracene Chrysene Bis(2-Ethylhexyl)Phthalate Di-n-Octyl Phthalate Benzo(b)Fluoranthene Benzo(k)Fluoranthene Benzo(a)Pyrene Indeno(1,2,3-cd)Pyrene Dibenzo(a,h)Anthracene Benzo(g,h,i)Perylene	Location: Type: Date: Lab Log#: BNA Compounds
0.05 0.05 0.065 0.065 0.065 0.078 0.078 0.078 0.078 0.078 0.071 0.	333333333 CCCCCC CC	Inf-E comp 10/27/92 448280 ug/L
		Inf-1 grab 10/26/92 448281 ug/L
		Inf-2 grab 10/26/92 448282 ug/L
0.05 0.05 0.05 0.05 0.05 0.1 0.1 0.1 0.1 1 1 1 1 1 1 1 1 1 1 1 1	0000000000 CCCCCCCC	Eff-E comp 10/27/92 448288 ug/L
		Eff-2 grab 10/27/92 448290 ug/L
		Eff-1A grab 10/27/92 448300 ug/L
140 U	14000 U 14000 U 15000 U 14000 U 14000 U 14000 U 14000 U 14000 U	Sludge grab 10/26/92 448293 ug/kg
1.200 CCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCCC	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ 0 0 0 0 0 0 0 0	Sedmt-1 grab 11/12/92 448297 ug/kg-dr
	872 U 872 U 872 U 872 U 872 U 872 U 872 U 872 U	Sedmt-2 grab 11/12/92 448298 ug/kg-dr

Appendix D (cont.) - VOA, BNA, Pesticide/PCB and Metals Scan Results - Alderwood Water District - October 1992.

Antimony Arsenic Beryllium Cadmium Chromium Chro	Metals*
	Location: Type: Date: Lab Log#:
30 U 1.5 UN 1 UN 33.6 V 10.9 J 10.9 J 10 P 10 P 2.5 U	Inf-E comp 10/27/92 448280 ug/L
z	Inf-1 grab 10/26/92 448281 ug/L
	Inf-2 grab 10/26/92 448282 ug/L
1.5 U 1.5 U 1.5 U 1.5 U 1.5 U 1.5 U 1.5 U 1.5 U 1.5 U	Eff-E comp 10/27/92 448288 ug/L
2	Eff-2 grab 10/27/92 448290 ug/L
	Eff-1A grab 10/27/92 448300 ug/L
3.28 0.1 U 7.97 16.8 398 266 1.03 J 37.4 37.7 103 N 0.25 U	Sludge grab 10/26/92 448293 mg/Kg-dr
2.77 0.13 P 0.36 P 24.2 5.39 8.97 0.013 PJ 27.9 U 0.31 PN 0.25 U	Sedmt-1 grab 11/12/92 448297 mg/Kg-dr
2.11 0.12 P 0.2 U 16 3.13 B 4.7 P 0.011 PJ 14.3 0.4 U 0.25 U 20.5	Sedmt-2 grab 11/12/92 448298 mg/Kg-dr

Results are reported as total metals for Hg in the water samples, and for the sludge and sediment samples. Results are reported as total recoverable metals for the remaining metals in the water samples. Analyte was also found in the analytical method blank indicating the sample may have been contaminated.

The analyte was positively identified. The associated numerical result is an estimate.

For organic analytes there is evidence the analyte is present in the sample. For metals analytes the spike sample recovery is not with in control limits.

The analyte was detected above the instrument detection limit but below the established minimum quantification limit.

^{725@ *}

Appendix E

Tentatively Identified Compounds - Alderwood Water District - October 1992.

SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET TENTATIVELY IDENTIFIED COMPOUNDS

448280

EPA SAMPLE NO.

Lab Name: WEYERHAEUSER Contract: 8270

Lab Code: WEYER Case No.: 10102 SAS No.: SDG No.: 448280

Matrix: (soil/water) WATER Lab Sample ID: 98768

Sample wt/vol: 1000 (g/mL) ML Lab File ID: 2BN21111F

Level: (low/med) LOW Date Received: 10/28/92

* Moisture: decanted: (Y/N) Date Extracted: 10/30/92

Concentrated Extract Volume: 1000 (uL) Date Analyzed: 11/11/92

Injection Volume: 2.0(uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH:

Number TICs found: 20 CONCENTRATION UNITS: (ug/L or ug/Kg) UG/L

CAS NUMBER	COMPOUND NAME	RT	EST. CONC.	Q
1.	UNKNOWN	5.38	82	J
2. 54446-78-5	ETHANOL, 1-(2-BUTOXYETHOXY)-	10.94	19	JN
3. 10482-56-1		11.07	35	JN
4. 143-07-7	DODECANOIC ACID	17.64	37	JN
5. 629-76-5	1-PENTADECANOL	20.47	63	JN
6. 544-63-8	TETRADECANOIC ACID	20.60	28	JN
7. 58-08-2	1H-PURINE-2,6-DIONE, 3,7-DIH	21.55	27	JN
8. 36653-82-4	1-HEXADECANOL	21.85	50	JN
9. 57-10-3	HEXADECANOIC ACID	23.70	830	JN
10.	UNKNOWN	24.12	12	J
11.	UNKNOWN	24.44	51	J
12.	UNKNOWN	25.86	1000	J
13. 57-11-4	OCTADECANOIC ACID	26.16	480	JN
14.	UNKNOWN	26.47	17	J
15.	UNKNOWN	27.54	13	J
16.	UNKNOWN	27.79	34	J
17.	UNKNOWN	27.82	18	J
18.	UNKNOWN	32.14	110	J
19.	UNKNOWN	34.69	62	J
20. 57-88-5	CHOLEST-5-EN-3-OL (3.BETA.)-	35.04	66	JN

1E VOLATILE ORGANICS ANALYSIS DATA SHEET TENTATIVELY IDENTIFIED COMPOUNDS

EPA SAMPLE NO.

448281

Lab Name: WEYERHAEUSER Contract: 046-5751

Lab Code: WEYER Case No.: 10102

SDG No.: 448280

Matrix: (soil/water) WATER Lab Sample ID: 98769

Sample wt/vol: 5.0 (g/mL) ML Lab File ID: B9036

Level: (low/med) LOW Date Received: 10/28/92

Noisture: not dec. Date Analyzed: 10/30/92

GC Column: CAP ID: 0.530 (mm) Dilution Factor: 1.0

Soil Extract Volume: (uL) Soil Aliquot Volume: (uL)

SAS No.:

CONCENTRATION UNITS:

Number TICs found: 11 (ug/L or ug/Kg) UG/L

CAS NUMBER	COMPOUND NAME	RT	EST. CONC.	Q
1. 115106	Methane, oxybis-	6.61	17	JN
2. 541059	Cyclotrisiloxane, hexamethyl		250	JN
3. 103651	Benzene, propyl-	27.28	11	JN
4. 0	Benzene, ethyl-methyl- isome	27.52	61	JN
5. 556672	Cyclotetrasiloxane, octameth	27.70	330	JN
6. 0	Benzene, ethyl-methyl- isome	28.20	22	JN
7. 526738	Benzene, 1,2,3-trimethyl-	28.68	96	JN
8. 138863	Limonene	29.49	23	JN
9. 620144	Benzene, 1-ethyl-3-methyl-	29.91	. 18	JN
10. 496117	1H-Indene, 2,3-dihydro-	30.44	10	JN
11. 99876	Benzene, 1-methyl-4-(1-methy	31.07	11	JN

SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET TENTATIVELY IDENTIFIED COMPOUNDS

Lab Name: WEYERHAEUSER Contract: 8270 448288

SDG No.: 448280

Lab Code: WEYER Case No.: 10102 SAS No.:

Natrix: (soil/water) WATER

Lab Sample ID: 98774

Sample wt/vol:

1000 (g/mL) ML

Lab File ID: 2BN21111G

Level: (low/med) LOW

Date Received: 10/28/92

* Moisture:

decanted: (Y/N)

Date Extracted: 10/30/92

Concentrated Extract Volume: 1000 (uL)

Date Analyzed: 11/11/92

Injection Volume: 2.0(uL)

Dilution Factor:

1.0

GPC Cleanup: (Y/N) N

pH:

Number TICs found: 20

CONCENTRATION UNITS: (ug/L or ug/Kg) UG/L

CAS NUMBER	COMPOUND NAME	RT	EST. CONC.	Q
1. 20324-32-7	2-PROPANOL, 1-(2-METHOXY-1-M	7.07	5	JN
2.	UNKNOWN	7.13	4	J
3.	UNKNOWN	7.35	8	
4. 112-34-5	ETHANOL, 2-(2-BUTOXYETHOXY)-		7	JN
5. 124-17-4	ETHANOL, 2-(2-BUTOXYETHOXY)-	13.97	36	JN
6.	UNKNOWN	14.17	2	J
7.	UNKNOWN	14.79	4	J
8. 143-07-7	DODECANOIC ACID	17.34	5	JN
9. 544-63-8	TETRADECANOIC ACID	20.22	6	JN
10.	UNKNOWN	20.57	6	J
11. 5746-58-7	TETRADECANOIC ACID, 12-METHY	21.20	2	JN
12. 58-08-2	1H-PURINE-2,6-DIONE, 3,7-DIH	21.37	17	JN
13. 2091-29-4	9-HEXADECENOIC ACID	22.65	16	JN
14. 57-10-3	HEXADECANOIC ACID	22.97	40	JN
15.	UNKNOWN	25.09	48	J
16. 57-11-4	OCTADECANOIC ACID	25.39	32	JN
17.	UNKNOWN	25.87	3	J
18.	UNKNOWN	32.06	8	J
19.	UNKNOWN	34.62	10	J
20. 57-88-5	CHOLEST-5-EN-3-OL (3.BETA.)-		11	JN

VOLATILE ORGANICS ANALYSIS DATA SHEET TENTATIVELY IDENTIFIED COMPOUNDS

EPA SAMPLE NO.

448290

Lab Name: WEYERHAEUSER

Contract: 046-5751

Lab Code: WEYER Case No.: 10102

SAS No.:

SDG No.: 448280

Matrix: (soil/water) WATER

Lab Sample ID: 98775

Sample wt/vol:

5.0 (g/mL) ML

Lab File ID:

B9041

Level: (low/med) LOW

Date Received:

10/28/92

* Moisture: not dec.

Soil Extract Volume:

ID: 0.530 (mm)

Dilution Factor: 1.0

GC Column: CAP

(uL)

Soil Aliquot Volume: (uL)

Date Analyzed: 10/30/92

CONCENTRATION UNITS: (ug/L or ug/Kg) UG/L

Number TICs found: 2

CAS NUMBER RT EST. CONC. COMPOUND NAME Q ______ 1. 541059 HEXAMETHYLCYCLOTRISILOXANE 20.61 14 JN 2. 556672 Cyclotetrasiloxane, octameth 27.70 6 JN

448293

SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET TENTATIVELY IDENTIFIED COMPOUNDS

Lab Name: WEYERHAEUSER Contract: 8270

Lab Code: WEYER Case No.: 10102 SAS No.: SDG No.: 448280

Matrix: (soil/water) SOIL Lab Sample ID: 98777

Lab File ID: 2BN21111E Sample wt/vol: 30.2 (g/mL) G

Date Received: 10/28/92 Level: (low/med) LOW

% Moisture: 88 decanted: (Y/N) N Date Extracted: 11/02/92

Concentrated Extract Volume: 500.0 (uL) Date Analyzed: 11/11/92

Dilution Factor: 5.0 Injection Volume: 2.0(uL)

GPC Cleanup: (Y/N) Y pH: 6.8

CONCENTRATION UNITS: Number TICs found: 20 (ug/L or ug/Kg) UG/KG

CAS NUMBER	COMPOUND NAME	RT	EST. CONC.	Q
1. 26730-14-3	TRIDECANE, 7-METHYL-	12.37	39000	JN
2. 74645-98-0	DODECANE, 2,7,10-TRIMETHYL-	16.27	44000	JN
3. 544-63-8	TETRADECANOIC ACID	20.54	28000	אע
4.	UNKNOWN	21.40	120000	J
5. 5746-58-7	TETRADECANOIC ACID, 12-METHY	21.50	34000	JN
6.	UNKNOWN	21.84	66000	J
7. 2091-29-4	9-HEXADECENOIC ACID	23.15	930000	JN
8. 57-10-3	HEXADECANOIC ACID	23.65	920000	JN
9. 506-12-7	HEPTADECANOIC ACID	24.00	21000	JN
10.	UNKNOWN	24.19	39000	J
11.	UNKNOWN	24.40	28000	J
12.	UNKNOWN	25.89	2500000	J
13. 57-11-4	OCTADECANOIC ACID	26.06	440000	JN
14.	UNKNOWN	26.12	41000	J
15.	UNKNOWN	26.41	22000	J
16.	UNKNOWN	27.76	50000	J
17.	UNKNOWN	28.92	57000	J
18.	UNKNOWN	32.16	170000	J
19.	UNKNOWN	34.72	110000	J
20. 57-88-5	CHOLEST-5-EN-3-OL (3.BETA.)-	35.11	150000	JN

1E

VOLATILE ORGANICS ANALYSIS DATA SHEET TENTATIVELY IDENTIFIED COMPOUNDS

EPA SAMPLE NO.

448300

Lab Name: WEYERHAEUSER

Contract: 046-5751

Lab Code: WEYER Case No.: 10102 SAS No.:

SDG No.: 448280

Matrix: (soil/water) WATER

Lab Sample ID: 98778

5.0 (g/mL) ML

Lab File ID:

B9042

Sample wt/vol:

Level: (low/med) LOW

Date Received:

10/28/92

* Moisture: not dec.

Date Analyzed: 10/30/92

GC Column: CAP ID: 0.530 (mm)

Dilution Factor: 1.0

Soil Extract Volume:

(uL)

Soil Aliquot Volume: (uL)

CONCENTRATION UNITS: (ug/L or ug/Kg) UG/L

Number TICs found:

1

	CAS NUMBER	COMPOUND NAME	RT	EST. CONC.	Q
	1. 541059	Cyclotrisiloxane, hexamethyl	20.58	9	JN
1					

1E

VOLATILE ORGANICS ANALYSIS DATA SHEET TENTATIVELY IDENTIFIED COMPOUNDS

EPA SAMPLE NO.

448293

Lab Name: WEYERHAEUSER Contract: 046-5751

Lab Code: WEYER Case No.: 10102 SAS No.: SDG No.: 448280

Matrix: (soil/water) SOIL Lab Sample ID: 98777

2.5 (g/mL) GSample wt/vol: Lab File ID: A2937

Level: (low/med) LOW Date Received: 10/28/92

* Moisture: not dec. 88 Date Analyzed: 10/29/92

GC Column: CAP ID: 0.530 (mm) Dilution Factor: 1.0

Soil Extract Volume: (uL) Soil Aliquot Volume: (uL)

CONCENTRATION UNITS:

Number TICs found: (ug/L or ug/Kg) UG/KG

CAS NUMBER	COMPOUND NAME	RT	EST. CONC.	Q
1. 75183	Methane, thiobis- Disulfide, dimethyl Trisulfide, dimethyl Limonene Undecane Naphthalene, decahydro-2-met	5.49	680	ЈИ
2. 624920		16.41	2700	ЈИ
3. 3658808		27.90	770	ЈИ
4. 138863		28.41	630	ЈИ
5. 1120214		29.98	100	ЈИ
6. 2958761		31.76	170	ЈИ